


To ensure the proper use of the product, please read this instruction manual thoroughly.

HEIGHT SETTER COMPONENTS

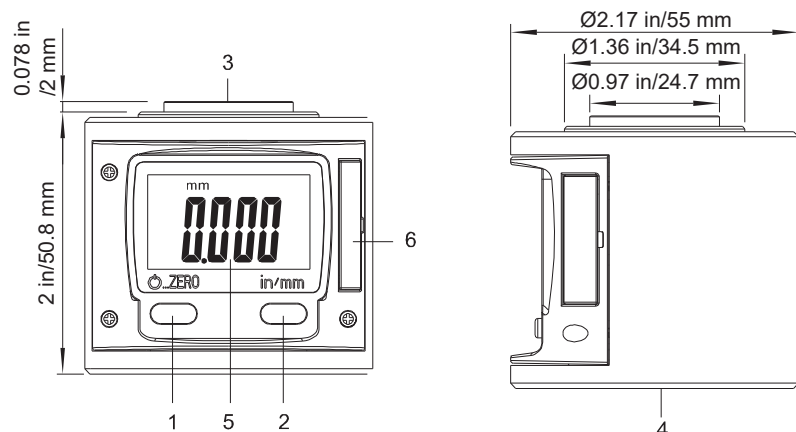

1. ϕ / ZERO button: Press and hold to set zero. Press and quickly release to power on/off.
Note: Unit will turn on when measuring face is actuated.
2. in / mm button: Press and quickly release to change the displayed unit of measurement.
3. Contact surface
4. Magnets
5. LED Display: Lights up when contact surface is within $\pm 0.0002"$ / $\pm 0.005\text{mm}$
6. Battery

FEATURES

1. Inductive measurement system: Used to measure the displacement of height
2. Auto power-off when idle for 5 minutes
3. Powers on automatically when contact surface is actuated


PRODUCT CHARACTERISTICS

Resolution	0.00005"/0.001mm
Accuracy	0.0002"/0.005mm
Repeatability	0.0001"/0.003mm
Protection Grade	IP65
Range (50mm)	0-0.110" / 0-2.7 mm
Battery	CR2032
Response speed 1.6m/s	1.6m/s


50MM HEIGHT SETTER

INSTRUCTIONS

1. Set zero by placing the contact surface against a flat surface, or the included gauge pin if supplied.

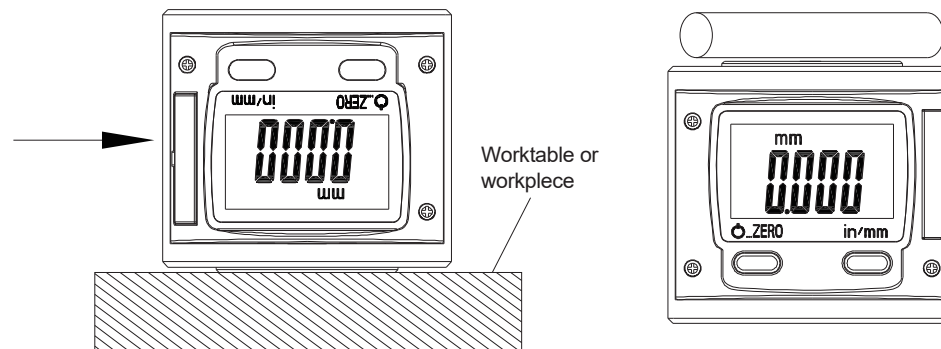

2. Place the bottom end on a ferrous surface to fix the height setter in place. Slowly descend the cutting tool onto the contact surface until the LED display lights up and reaches zero.

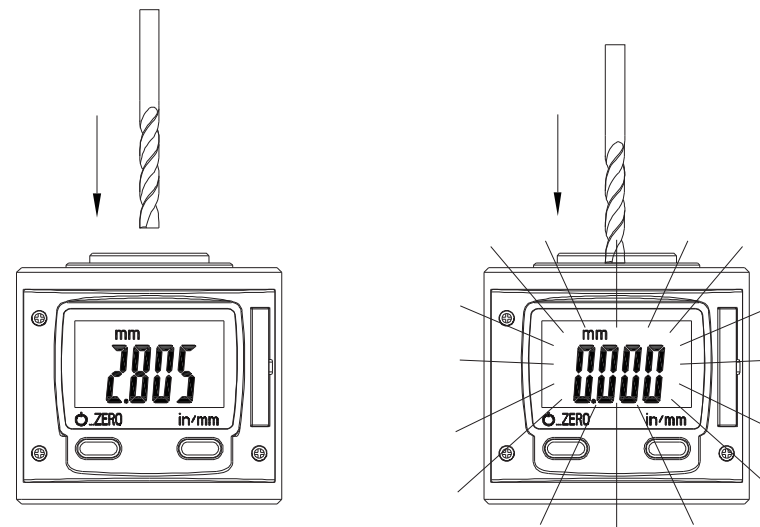

NOTE: The height setter will reset to factory settings after 8 hours, requiring the zero point to be reconfigured.